NAVSHIPREPFAC YOKOSUKA LOCAL STANDARD ITEM

FY-00

ITEM NO: 099-62YO
DATE: 01 JUL 1998
CATEGORY: II

1. SCOPE:

1.1 Title: Boiler Handhole and Manhole Seats and Plates; inspect

2. REFERENCES:

- a. S9221-C1-GTP-010, Repair and Overhaul Main Propulsion Boilers
- b. 803-841316, Handhole Plates and Arch Bars for Boilers

3. REQUIREMENTS:

- 3.1 Remove handhole and manhole plates from headers and drums of boilers. Plates shall be identified and tagged as to respective boilers.
- 3.2 Wirebrush clean to bare metal handhole and manhole plates, studs, strongbacks, and fasteners. Wirebrush clean to bare metal handhole and manhole gasket seating surfaces using a power driven wire cupbrush. Ensure complete removal of rust and gasket material.
- 3.3 Visually inspect gasket seating surfaces of handhole and manhole plates and the drum and header for erosion, corrosion, gouges, steam cuts, crack indications, excessive pitting, grooves, and any irregularities that may cause poor or leaky joints. Inspect studs and nuts for deterioration and damaged and stripped threads.
- 3.3.1 Visually inspect, measure, and record the following handhole and manhole gasket seating surface criteria in accordance with Paragraph 5-8.2 of 2.a and Attachment A.
- 3.3.1.1 Seat taper: Use template of flat stock and feeler gage to measure maximum taper around periphery of handhole and manhole seats.
- 3.3.1.2 Minimum wall thickness: Measure header wall thickness using a point micrometer at each side of the header cross sectional minor axis.
 - 3.3.1.3 Minimum seat thickness: Measure header

1 of 3 ITEM NO: $\frac{099-62YO}{FY-00}$


seat thickness with a flat-faced micrometer at the four points of the header cross sectional major and minor axis.

- 3.3.1.4 Handhole plate overlap: Measure maximum gap clearance between shoulder of the handhole plate and handhole with handhole plate located in the most extreme misaligned position. Subtract the measurement from the plate seat width to establish the amount of plate overlap. Handhole plates used for measurements shall conform to 2.b.
- 3.3.1.5 Manhole plate clearance: Measure clearance between shoulder of manhole plate and manhole at eight 45-degree increments, with the manhole plate accurately centered.
- 3.4 Submit four legible copies of a report listing results of the requirements of 3.3 to NAVSHIPREPFAC. Report shall list each handhole and manhole seat which failed to meet the minimum allowable values listed in Appendices 5D, 5E and 6C of 2.a.
- 3.5 Install handhole and manhole plates, using new gaskets conforming to MIL-G-15342 and applicable boiler technical manual.

4. NOTES:

4.1 Equipment technical manual will be referenced in the invoking Work Item.

> 2 of 3 ITEM NO: 099-62YO

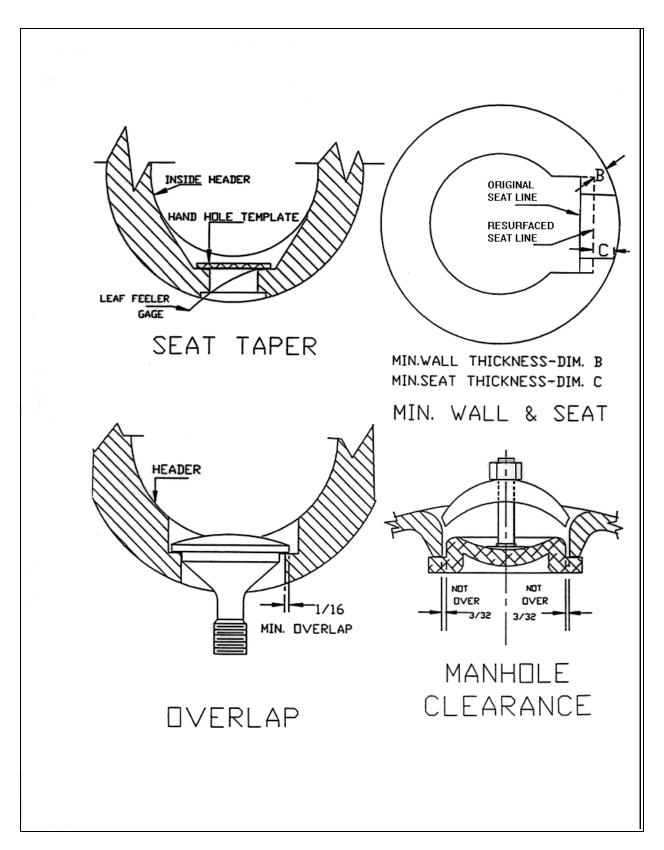

Attachment A

3 of 3 ITEM NO: $\frac{099-62YO}{FY-00}$